









# Sample Trend

Database: FA-ST BOATCARE	Equipment: E10 - CRANCHI 37 FOXY JO
Area: C519 - BOATCARE YACHT SURVEYS (C)	Point: P2 - STBD ENGINE KAD 300-285HP

Sample Date	02/12/2015			
Sample #	1696719			
Unit Usage	350			
Oil Usage				
Oil Added				

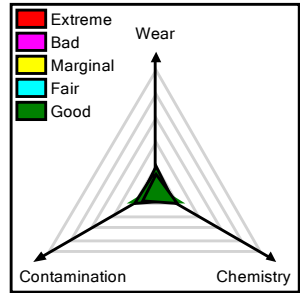

<b>Wear</b>	<b>0</b>			
Aluminum	5.00			
Chromium	4.00			
Copper	5.00			
Iron	66.0			
Lead	3.00			
Nickel	4.00			
Silver	0.00			
Tin	2.00			
Titanium	0.00			
Vanadium	0.00			
FW Idx	0			

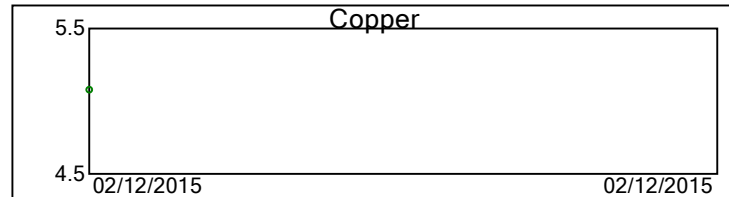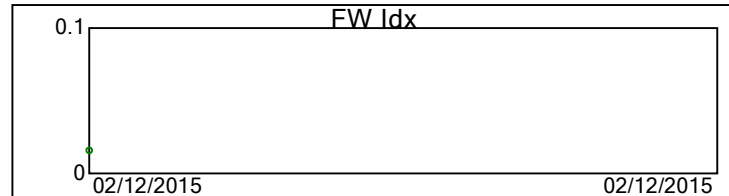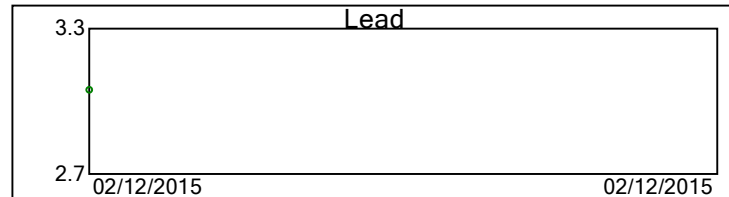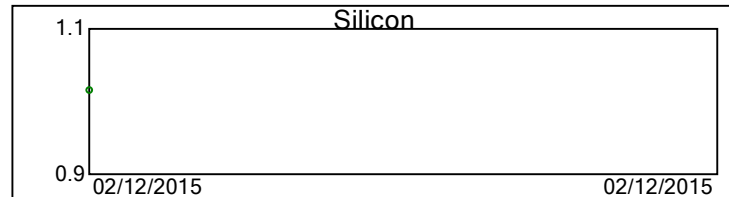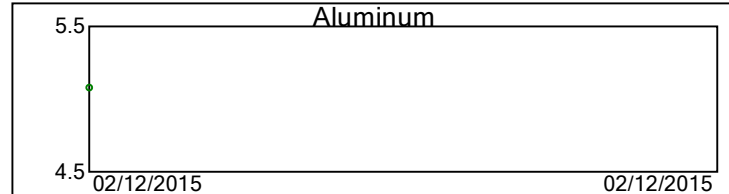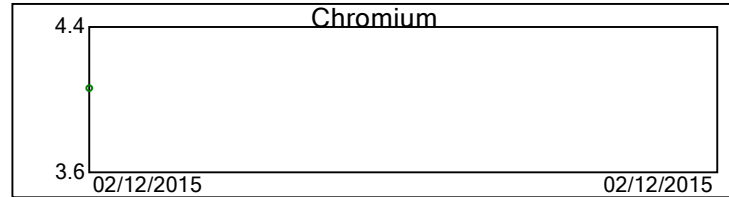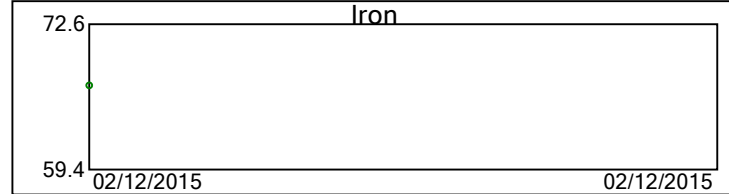

<b>Contamination</b>	<b>0</b>			
Boron	47.00			
Silicon	1.00			
Sodium	4.00			
IR Soot	32.00			
Water K.Fish	0.0			

<b>Chemistry</b>	<b>0</b>			
Calcium	2,910.00			
Magnesium	64.00			
Molybdenum	21.00			
Phosphorus	1,031.00			
Zinc	1,438.00			
Manganese	1.00			
IR Oxidation	0.00			
IR Nitration	14.00			
IR Sulfation	0.00			
Visc 40C	109.1			

WEAR READINGS LOOK OK. RESAMPLE AS NORMAL.